

Skymningsrelä









1.

LIGHT DEPENDENT RELAYS

PURPOSE

Light dependent relay serves to switch-ON the lighting of streets, squares, shop windows, neon lamps etc, at twilight and to switch-OFF afore mentioned lighting at dawn.

FUNCTIONING


The relay should be situated at place with permanent access to day light, which, due to its changes of intensity, will cause switching ON and OFF the lighting. The exact time of switching the lighting can be set by potentiometer by the user. Turn in the direction of "half moon" will delay switching-ON, turning in the direction of "sun" will advance switching-ON. The relay is equipped with a delay system, which delays switching ON and OFF the lighting, thus eliminating the influence of accidental disturbances like thunder lightings on the relay functioning.

WITH INTERNAL LIGHT DEPENDENT SENSOR

AZH

10A. Hermetic.






supply		230V AC
current load		<10A
switching threshold (setting		
switching threshold (factory	setting) ok. 7Lx
histeresis		ok. 15Lx
switching ON delay		1÷15sec
switching OFF delay		10÷30sec
power consumption		0,56W
connection cable	cable	3×0,75mm ² ; I=0,8m
working temperature		-25÷50°C
dimensions		50×67×26mm
fixing	two	screws to substrate
protection level		IP65

AZH-106

16A. Hermetic.






supply		230V AC
current load		<16A
switching threshold (setting ra		2÷1000Lx
switching threshold (factory se	etting)	ok. 7Lx
histeresis		ok. 15Lx
switching ON delay		1÷15sec
switching OFF delay		10÷30sec
power consumption		0,56W
connection cable	cable	3×1mm2; I=0,8m
working temperature		-25÷50°C
dimensions		50×67×26mm
fixing	two so	rews to substrate
protection level		IP65

AZH-C

10A. Miniature. Hermetic.





supply		230V AC
current load		<10A
switching threshold (setting	range)	2÷1000Lx
switching threshold (factory	setting) ok. 7Lx
histeresis		ok. 15Lx
switching ON delay		1÷15sec
switching OFF delay		10÷30sec
power consumption		0,56W
connection cable	cable	3×0,75mm ² ; I=0,5m
working temperature		-25÷50°C
dimensions		81×33×25mm
fixing	two	screws to substrate
protection level		IP65




AWZ 16A. Hermetic. With internal connection. **AWZ-30** 30A. Hermetic. With internal connection.





Llight dependent relay in box with special sealing flange, fastened to the substrate by two screws, closed by a cover with silicongasket and tightened by 4 screws.






supply		230V AC
current load		<16A
switching threshold (setting	range)	2÷1000Lx
switching threshold (factory	setting)	ok. 7Lx
histeresis		ok. 15Lx
switching ON delay		1÷15sec
switching OFF delay		10÷30sec
power consumption		0,8W
connection	screw	terminals 2,5mm ²
working temperature		-25÷50°C
dimensions		60×85×35mm
fixing	two sc	rews to substrate
protection level		IP65

WITH EXTERNAL HERMETIC PROBE

AZH-S / AZH-S PLUS





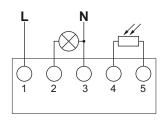


230V AC
<16A
nge) 2÷1000Lx
etting) ok. 7Lx
ok. 15Lx
1÷15sec
10÷30sec
0,56W
screw terminals 2,5mm ²
-25÷50°C
50×67×26mm
two screws to substrate

External hermetic probe Ø10 or PLUS (see item 1/9) including with automatic twilight sensor.

AZ-B / AZ-B PLUS AZ-B UNI / AZ-B PLUS UNI





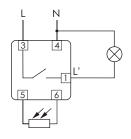


supply AZ-B / AZ-B PLUS	230V AC
AZ-B UNI / AZ-B PLUS U	JNI 12÷264V AC/DC
current load	<16A
switching threshold (setting ran	nge) 2÷1000Lx
switching threshold (factory set	tting) ok. 7Lx
histeresis	ok. 15Lx
switching ON delay	1÷15sec
switching OFF delay	10÷30sec
power consumption	0,56W
connection	screw terminals 2,5mm ²
working temperature	-25÷50°C
dimensions	2 modules (35mm)
fixing	on rail TH-35

External hermetic probe Ø10 or PLUS (see item 1/9) including with automatic twilight sensor.

AZ-112 / AZ-112 PLUS





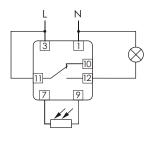

supply	230V AC
contact	1N/O
current load	<16A
switching threshold (setting ra	inge) 2÷1000Lx
switching threshold (factory se	etting) ok. 7Lx
histeresis	ok. 15Lx
switching ON delay	1÷15sec
switching OFF delay	10÷30sec
power consumption	0,8W
connection	screw terminals 2,5mm ²
working temperature	-25÷50°C
dimensions	1 module (18mm)
fixing	on rail TH-35

External hermetic probe Ø10 or PLUS (see item 1/9) including with automatic twilight sensor.




Hermetic external probe

PLUS

Applied in sets: AZH-S PLUS, AZ-B PLUS, AZ-112 PLUS. Available separately.



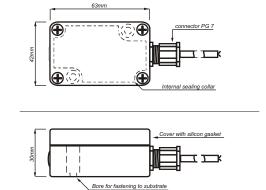


Optical sensor in convenient low dimensioned casing, to be connected by connector PG7 with round cable Ømax7 mm, (for ex. 2x0,5mm²) of length acc to necessity, Box with special sealing flange, fastened to the substrate by two screws, closed by a cover with silicon gasket and tightened by 4 screws.

Ø10

Applied in sets: AZH-S, AZ-B, AZ-112. Available separately.






Little, easy to mount light dependent sensor with 1 meter cable with posibility to extend (connection of leads should be made in hermetic distribution box or at a place free from atmospheric influence.

ATTENTION!

The external probe should be situated at place with permanent access to day light, which, due to its changes of intensity, will cause switching ON and OFF the lighting.

When length of connecting cable of external probe exceeds 10m it should not be laid in vicinity of a parallel conductor under mains voltage, or conducting great currents. In any case always connect correctly phase and neutral leads to the light dependent relay.

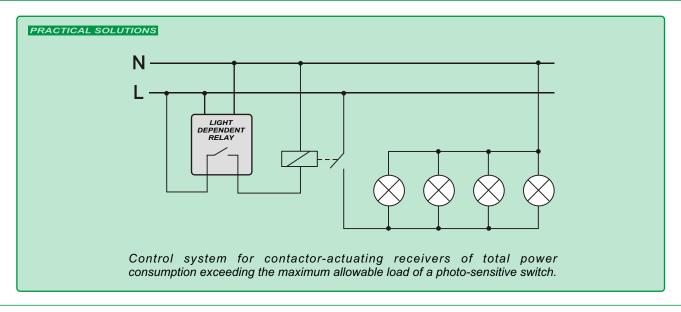

ATTENTION!

Automatic twilight sensors for other voltages than specified in the technical data table are also available on special request (24V, 48V, and 110V AC/DC and other).